

Job Site Repair LLC

12015 Brockton Ln N

Maple Grove, MN. 55369

Phone: 763-428-8891 Fax: 866-454-6909

INVOICE**231747****INVOICE**

Ref # : 311453

Printed Date: 05/10/2023

Work Completed: 05/08/2023**Mroczek Transportation, Inc. - Phillip Mroczek**

12866 Echo Lane

Apple Valley, MN 55124

Cellular 402-450-9775

1999 Freightliner -

Lic # : YBX3340

Odometer In : 451756

Unit # : 311453

VIN # : 4UZA4FF40 XCA50040

| Part Description | Qty | Sale | Ext | Labor Description | Ext |
|---------------------------|--------|--------|----------|--|--------|
| Seal | 1.000 | 37.15 | 37.15 | Work Requested: Blown brakes, leaks from left front, | n/c |
| Race wheel | 1.000 | 16.27 | 16.27 | PM | |
| Bearing wheel | 1.000 | 25.05 | 25.05 | Labor | 550.00 |
| Bearing race wheel | 1.000 | 26.64 | 26.64 | Clamp off leaking front left caliper and limp vehicle to shop. | |
| Bearing wheel | 1.000 | 70.04 | 70.04 | Remove front left hub assembly, bearings and races worn out, | |
| Brake rotor | 1.000 | 289.12 | 289.12 | replace bearings and races, reassemble with new rotor , caliper, | |
| Brake Caliper | 2.000 | 178.61 | 357.22 | caliper spring kit, wheel seal and hub cap. Replace front brake | |
| Brake Caliper Kit | 2.000 | 54.10 | 108.20 | pads. | |
| Front wheel hub oil cap | 1.000 | 39.67 | 39.67 | Labor | 110.00 |
| Brake Disc Pads | 1.000 | 68.83 | 68.83 | Steer shaft u-joints worn out, remove shaft, replace u-joints and | |
| U Joint | 2.000 | 30.39 | 60.78 | reinstall. | |
| Air filter | 1.000 | 117.17 | 117.17 | Labor | 27.50 |
| Clamp Hose | 1.000 | 3.27 | 3.27 | Replace dirty air filter and broken lower clamp | |
| W/wiper blade | 2.000 | 10.53 | 21.06 | Labor | 27.50 |
| Pigtail | 1.000 | 2.76 | 2.76 | Replace worn wiper blades | |
| Light amber LED | 2.000 | 24.47 | 48.94 | Labor | 82.50 |
| Light red LED | 1.000 | 19.99 | 19.99 | Inspect lights, replace burnt out upper far left and right side hood | |
| Tank fuel strap insulator | 1.000 | 49.22 | 49.22 | marker lights. Replace dim far left rear upper marker light. All | |
| Fuel strap | 2.000 | 94.86 | 189.72 | lights work properly after repairs. | |
| U Joint | 1.000 | 45.07 | 45.07 | Labor | 110.00 |
| Strap U-joint | 1.000 | 17.40 | 17.40 | Inspect for fuel leaks, found drain plug loose, tighten down plug, | |
| Pipe Exhaust turbo | 1.000 | 142.61 | 142.61 | add strap insulation to tank straps. Replace bent straps and secure | |
| Clamp outlet Turbo | 1.000 | 29.01 | 29.01 | tank. | |
| Clamp exhaust | 1.000 | 10.17 | 10.17 | Labor | 82.50 |
| Muffler clamp | 1.000 | 9.38 | 9.38 | Rear u-joint loose and worn, remove drive shaft and replace u-joint. | |
| Tie rod tube F/Liner | 1.000 | 561.59 | 561.59 | Reinstall with new strap kit. | |
| Drag link | 1.000 | 382.24 | 382.24 | Labor | 110.00 |
| Spring Pack | 2.000 | 712.41 | 1,424.82 | Replace leaking turbo down pipe and flange. No leaks noted after | |
| U bolt | 4.000 | 26.35 | 105.40 | repairs. | |
| Bolt 3/4 x 5 1/2 | 4.000 | 20.09 | 80.36 | Labor | 220.00 |
| Screw | 1.000 | 12.14 | 12.14 | Replace worn tie rod and drag link, set toe in at 1/16". | |
| Brake Disc Pads | 1.000 | 68.83 | 68.83 | Labor | 440.00 |
| Brake Caliper Shim .025 | 1.000 | 9.40 | 9.40 | Right front spring pack broken, order parts. Replace both front | |
| Brake line fitting | 2.000 | 5.52 | 11.04 | spring packs and hardware align and tighten in place. | |
| Brake line fitting | 5.000 | 1.46 | 7.30 | Labor | 550.00 |
| Brake Fluid | 1.000 | 13.53 | 13.53 | Left rear caliper damaged and brake lines leaking. Replace caliper | |
| Oil 10W30 Citgard 600 | 13.000 | 4.45 | 57.85 | and brake line. Replace rusted brake line from middle of vehicle to | |
| Filter Oil | 1.000 | 8.51 | 8.51 | rear. Replace rear brake pads and bleed brake system. | |
| Tire Disposal Fee | 2.000 | 15.00 | 30.00 | Labor | 55.00 |
| Job Supplies | | | 121.250 | Change oil filter fill engine oil. Vehicle came in almost empty on oil | |
| | | | | Labor tire | 60.00 |
| | | | | Replace 2 drive tires, air to 100 PSI. Tires were at 2 & 3/32". Used | |
| | | | | runout tires at 8/32"or replacements. | |

Visit us on the web: www.jobsiterepair.comEmail Address: jeff@jobsiterepair.com

Job Site Repair LLC
12015 Brockton Ln N
Maple Grove, MN. 55369
Phone: 763-428-8891 Fax: 866-454-6909

INVOICE

231747

INVOICE

Ref # : 311453

Printed Date: 05/10/2023

Work Completed: 05/08/2023

Mroczek Transportation, Inc. - Phillip Mroczek

12866 Echo Lane
Apple Valley, MN 55124
Cellular 402-450-9775

1999 Freightliner -

Lic # : YBX3340

Unit # : 311453

VIN # : 4UZA4FF40 XCA50040

Odometer In : 451756

| Part Description | Qty | Sale | Ext | Labor Description | Ext |
|------------------|-----|------|-----|-------------------|-----|
|------------------|-----|------|-----|-------------------|-----|

[Recommendations]

FAI due by 10/31/2023

| | | | | | |
|---------------|----------|-----------|------|------------------|----------|
| Org. Estimate | 7,459.40 | Revisions | 0.00 | Current Estimate | 7,459.40 |
|---------------|----------|-----------|------|------------------|----------|

| | |
|---------------|-----------------|
| Labor: | 2,425.00 |
| Parts: | 4,699.00 |

| | |
|------------------|-------------------|
| SubTotal: | 7,124.00 |
| Tax: | 335.40 |
| Total: | 7,459.40 |
| Bal Due: | \$7,459.40 |

[Payments -]

Vehicle Received: 5/8/2023

Customer Number : 38

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty work has to be performed in our shop & cannot exceed the original cost of repair.

Visit us on the web: www.jobsiterepair.com

Email Address: jeff@jobsiterepair.com